

**Meter Shop Comparison

Meters With AMR Units
(Nov 2005 – Aug 2006)

<i>Findings</i>	<i>LEAK</i>	<i>DR</i>	<i>STUCK</i>	<i>NOISE</i>	<i>SPECIAL</i>	<i>Total Meters</i>
Leak caused by AMR installation	0					0
Leak from worn seal behind center box	316	3			2	321
Body case leak	12					12
Gasket leak	34			1		35
No problem found	1	46	6	11	9	73
Non-retrofitable meter	17	32	4		3	56
Wiggler issue		16	4	1		21
Failure to remove gasket		24	2	2		28
Only meter is DR		55	15		1	71
Damage to Cellnet Device		19		1		20
Loose index mounting screws	1	30	7	3	2	43
Improper alignment of drive gears		150	24	14	2	190
Tight Screws (over-tightened)		5		1		6
No Leak found	54					54
<i>Total Meters With AMR Units</i>	435	380	62	34	19	930
<u>Meters Without AMR Units</u> (Nov 2005 – Aug 2006)	771	597	175	68	1588	3199
<u>Total Meters</u> (Nov 2005 – Aug 2006)	1206	977	237	102	1607	4129**

PLAINTIFF'S
 EXHIBIT
 3
 11-15-06 DR